


## Micro-Sensitive Drill Feed Adapter

- Micro-sensitive drill adapter only - chuck and drill sold separately
- 3/4" travel
- Simple to use: - Grasp free-turning knurled ring and feed with gentle finger pressure  
- Spring-loaded - when ring is released, chuck retracts automatically
- Sensitive drill feeds makes drilling of small holes easy by giving you fingertip feed control independent of coarser quill feed
- Makes drilling of small holes easy by giving you fingertip feed control
- Eliminates the need for special machines to drill small holes
- Reduces breakage and deflection of small drills

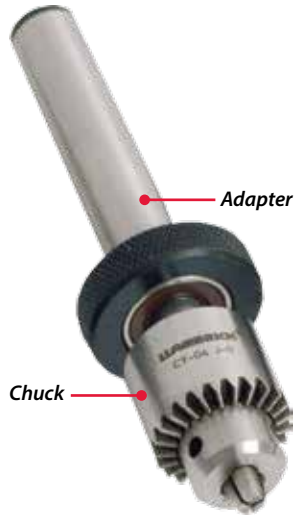

Shank Diameter (Inch)	Jacobs Taper	Code
1/2	JT0	820383

## Micro Drill Chuck & Key

**LLAMBRICH**

- Very accurate and sensitive for precise drilling
- To be used in mills, lathes, drill presses, jig bore and Swiss machines
- Eliminates the need of secondary operations to drill small holes
- Spindle speeds up to 50,000 RPM
- Feed with gentle finger pressure
- Free turning knurled ring with spring return upon release
- 3/4" total travel
- Standard 1/2" diameter straight shank or MT1 to go directly into the spindle of the machine

Model	Capacity (Inch)	Jacobs Mount	Diameter (Inch)	Length Closed (Inch)	Length Open (Inch)	Code
L40129B	1/64 - 5/32	JT0	0.866	1.102	1.378	827812

## Drill Chuck Arbors

### Hardened & Ground



Shank	Jacobs Taper	Code	Shank	Jacobs Taper	Code	Shank	Jacobs Taper	Code	Shank	Jacobs Taper	Code
MT1	J0	357200	1"	J2	360282	MT5	J4	360244	5/8"	J6	360266
MT2	J0	357210	ISA30	J2	363302	1/2"	J4	360254	3/4"	J6	360276
1/2"	J0	360250	ISA40	J2	363312	5/8"	J4	360264	1"	J6	360286
R8	J0	363330	ISA50	J2	363322	3/4"	J4	360274	ISA30	J6	363306
MT1	J1	357201	R8	J2	363332	1"	J4	360284	ISA40	J6	363316
MT2	J1	357211	MT1	J3	357203	ISA30	J4	363304	ISA50	J6	363326
MT3	J1	357221	MT2	J3	357213	ISA40	J4	363314	R8	J6	363336
1/2"	J1	360251	MT3	J3	357223	ISA50	J4	363324	MT1	J33	357207
5/8"	J1	360261	MT4	J3	357233	R8	J4	363334	MT2	J33	357217
ISA30	J1	363301	MT5	J3	360243	MT1	J5	357205	MT3	J33	357227
ISA40	J1	363311	1/2"	J3	360253	MT2	J5	357215	MT4	J33	357237
R8	J1	363331	5/8"	J3	360263	MT3	J5	357225	1/2"	J33	360257
MT1	J2	357202	3/4"	J3	360273	MT4	J5	357235	5/8"	J33	360267
MT2	J2	357212	1"	J3	360283	MT5	J5	360245	3/4"	J33	360277
MT3	J2	357222	ISA30	J3	363303	ISA50	J5	363325	1"	J33	360287
MT4	J2	357232	ISA40	J3	363313	R8	J5	363335	ISA30	J33	363307
MT5	J2	360242	ISA50	J3	363323	MT1	J6	357206	ISA40	J33	363317
1/2"	J2	360252	R8	J3	363333	MT2	J6	357216	ISA50	J33	363327
5/8"	J2	360262	MT1	J4	357204	MT3	J6	357226	R8	J33	363337
3/4"	J2	360272	MT2	J4	357214	MT4	J6	357236			
			MT3	J4	357224	MT5	J6	360246			
			MT4	J4	357234	1/2"	J6	360256			